

# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID:	N/A	Main Street: COMMONWEALTH AV			Location:	OnStreet
ADA ID:	742AFD9AFEC0	ParkingType:	AngParkAART	Overall Compliance:	No	Severity Score: 0.0
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance		



Possible Solutions:


**Advise relocating to an area with maximum 2% slopes**

Surveyor Notes:

**N/A**

PROW/ADA:

**TBD**

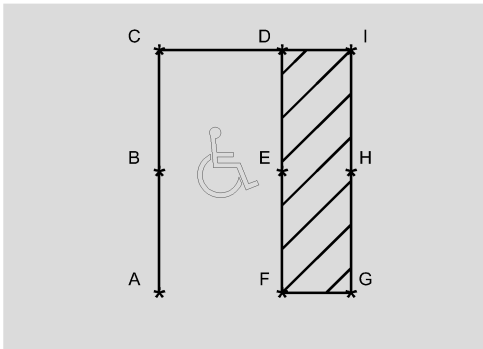

Total Cost:

**\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	N/A	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	120.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	1.0	No	Access Aisle Width (in)	91.0
Yes	Adjacent Sidewalk XSlope (%)	1.9	No	Access Aisle Length (in)	248.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	N/A
	No	Parking Spot Width (in)		101.0	
	No	Parking Spot Length (in)		248.0	
	N/A	Van Accessible?		Yes	
	Yes	Curb Ramp?		Yes	
	No	Identification Sign?		Yes	
	N/A	Sign Height (in)		48.5	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		No	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		No	
	N/A	Meter Clear Space?		No	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		No	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		No	
	N/A	Meter Parallel Reach (in)		N/A	

**No** Parking Space/Access Aisle Slopes (%)

C Slope (%)	4.4	D Slope (%)	1.0	I Slope (%)	2.6	L Slope (%)	N/A
B Slope (%)	0.1	E Slope (%)	0.1	H Slope (%)	0.9	K Slope (%)	N/A
A Slope (%)	0.4	F Slope (%)	0.1	G Slope (%)	1.1	J Slope (%)	N/A

**No** Parking Space/Access Aisle XSlopes (%)

C XSlope (%)	0.6	D XSlope (%)	3.3	I XSlope (%)	0.0	L XSlope (%)	N/A
B XSlope (%)	1.5	E XSlope (%)	2.2	H XSlope (%)	1.6	K XSlope (%)	N/A
A XSlope (%)	0.7	F XSlope (%)	0.2	G XSlope (%)	3.5	J XSlope (%)	N/A

