


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: 13019	Main Street: E_STONEWALL_ST	Location:	N/A
ADA ID: 7454D5CE4783	ParkingType: ParaPark	Overall Compliance: No	Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

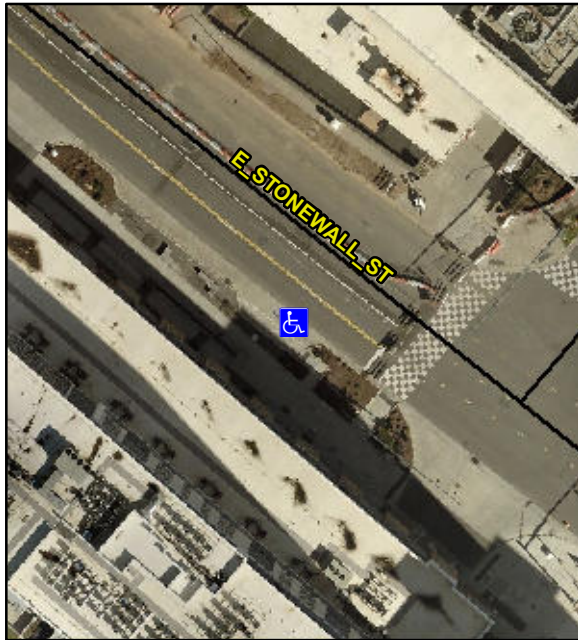

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

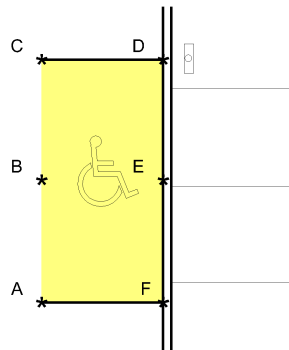

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	100.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	0.9	No	Access Aisle Width (in)	39.0
Yes	Adjacent Sidewalk XSlope (%)	1.9	No	Access Aisle Length (in)	289.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		88.0	
	N/A	Parking Spot Length (in)		289.5	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)							
	C Slope (%)	2.2	D Slope (%)	1.4	I Slope (%)	N/A	L Slope (%)	N/A
	B Slope (%)	1.0	E Slope (%)	1.4	H Slope (%)	N/A	K Slope (%)	N/A
	A Slope (%)	0.8	F Slope (%)	0.4	G Slope (%)	N/A	J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)							
	C XSlope (%)	1.8	D XSlope (%)	1.1	I XSlope (%)	N/A	L XSlope (%)	N/A
	B XSlope (%)	2.0	E XSlope (%)	1.1	H XSlope (%)	N/A	K XSlope (%)	N/A
	A XSlope (%)	0.5	F XSlope (%)	0.7	G XSlope (%)	N/A	J XSlope (%)	N/A

