


# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID: N/A	Main Street: GREENWOOD CLIFF RD	Location: N/A
ADA ID: 77BEB04FA26D	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

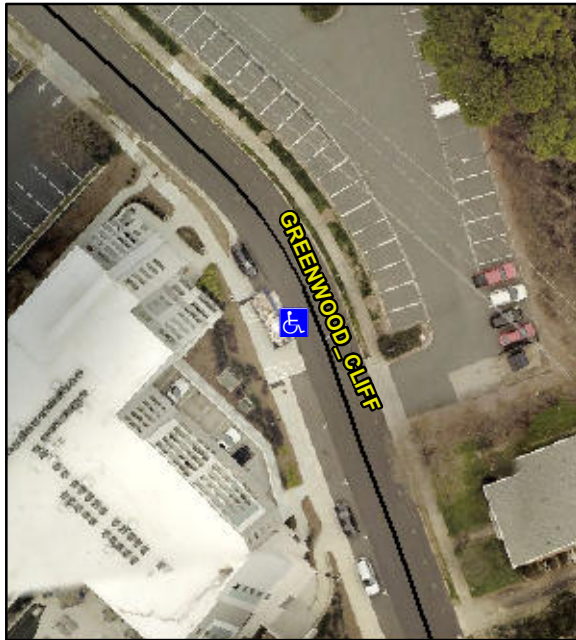

Possible Solutions:


**Advise relocating to an area with maximum 2% slopes**

Surveyor Notes:

**N/A**

PROW/ADA:

**TBD**

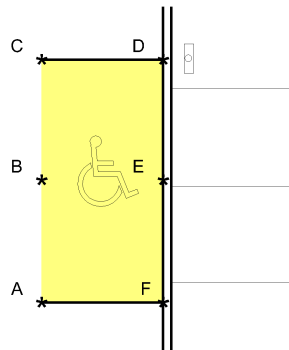

Total Cost: \$ \$0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	No	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	74.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	0.5	Yes	Access Aisle Width (in)	60
No	Adjacent Sidewalk XSlope (%)	3.0	No	Access Aisle Length (in)	229
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	Front
	N/A	Parking Spot Width (in)		91.0	
	N/A	Parking Spot Length (in)		229.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)							
	C Slope (%)	2.2	D Slope (%)	0.8	I Slope (%)	N/A	L Slope (%)	N/A
	B Slope (%)	1.8	E Slope (%)	0.0	H Slope (%)	N/A	K Slope (%)	N/A
	A Slope (%)	0.4	F Slope (%)	1.2	G Slope (%)	N/A	J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)							
	C XSlope (%)	2.1	D XSlope (%)	2.4	I XSlope (%)	N/A	L XSlope (%)	N/A
	B XSlope (%)	5.3	E XSlope (%)	5.2	H XSlope (%)	N/A	K XSlope (%)	N/A
	A XSlope (%)	4.5	F XSlope (%)	3.9	G XSlope (%)	N/A	J XSlope (%)	N/A

