


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: 10031762	Main Street: MIDWAY_PARK_DR	Location: N/A
ADA ID: 9CF2BA9AB540	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

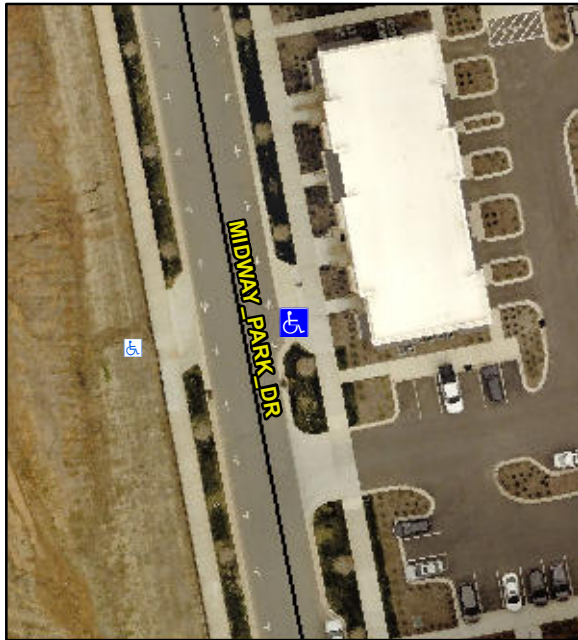

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

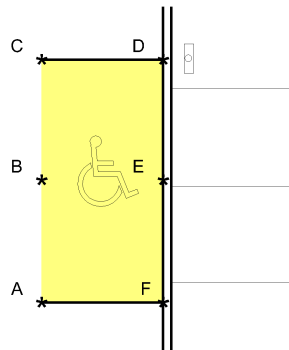

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	129.0	No	Access Aisle Marking?	No
Yes	Adjacent Sidewalk Slope (%)	0.2	N/A	Access Aisle Width (in)	59.0
Yes	Adjacent Sidewalk XSlope (%)	1.2	N/A	Access Aisle Length (in)	378.0
No	Adjacent Sidewalk Clear of Obstr.	No	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		81.5	
	N/A	Parking Spot Length (in)		403.5	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)					
	C Slope (%)	2.2	D Slope (%)	1.4	I Slope (%)	N/A
	B Slope (%)	2.6	E Slope (%)	2.2	H Slope (%)	N/A
	A Slope (%)	0.9	F Slope (%)	2.2	G Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)					
	C XSlope (%)	3.1	D XSlope (%)	5.0	I XSlope (%)	N/A
	B XSlope (%)	3.3	E XSlope (%)	2.9	H XSlope (%)	N/A
	A XSlope (%)	2.8	F XSlope (%)	2.1	G XSlope (%)	N/A
					L Slope (%)	N/A
					K Slope (%)	N/A
					J Slope (%)	N/A
					L XSlope (%)	N/A
					K XSlope (%)	N/A
					J XSlope (%)	N/A

