


Access Compliance Report Public Rights-of-Way (Accessible Street Parking)

Intersection ID: 10031761	Main Street: MIDWAY_PARK_DR	Location: N/A
ADA ID: A0DA847BA7BF	ParkingType: ParaPark	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Severity Score: 0.0
		Field Measurements/Component Compliance

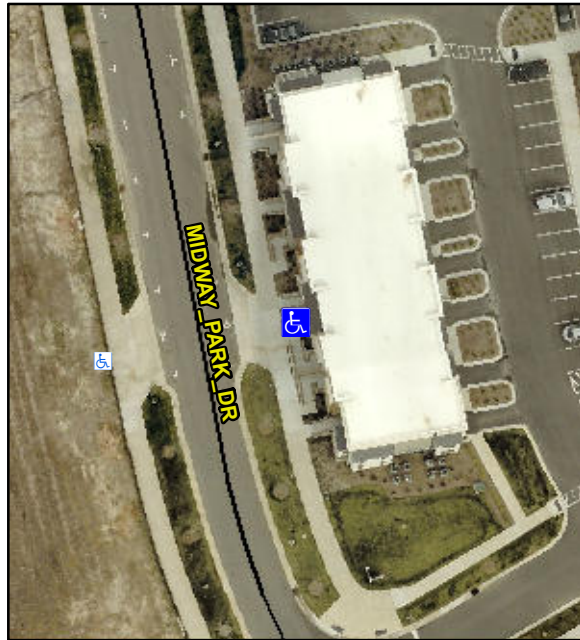

Possible Solutions:

Advise relocating to an area with maximum 2% slopes


Surveyor Notes:

N/A

PROW/ADA:

TBD

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	124.0	No	Access Aisle Marking?	No
Yes	Adjacent Sidewalk Slope (%)	1.6	N/A	Access Aisle Width (in)	70.0
Yes	Adjacent Sidewalk XSlope (%)	1.1	N/A	Access Aisle Length (in)	296.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		80.5	
	N/A	Parking Spot Length (in)		391.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

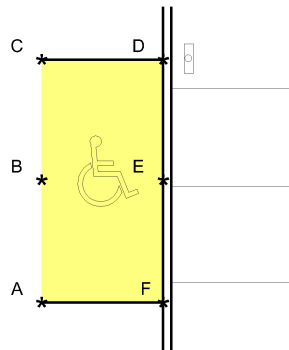

Total Cost: \$ \$0.00

N/A	Parking Space/Access Aisle Slopes (%)					
C Slope (%)	0.9	D Slope (%)	1.0	I Slope (%)	N/A	L Slope (%)
B Slope (%)	1.8	E Slope (%)	2.5	H Slope (%)	N/A	K Slope (%)
A Slope (%)	1.8	F Slope (%)	2.9	G Slope (%)	N/A	J Slope (%)
N/A	Parking Space/Access Aisle XSlopes (%)					
C XSlope (%)	4.1	D XSlope (%)	0.6	I XSlope (%)	N/A	L XSlope (%)
B XSlope (%)	3.1	E XSlope (%)	0.2	H XSlope (%)	N/A	K XSlope (%)
A XSlope (%)	4.2	F XSlope (%)	1.6	G XSlope (%)	N/A	J XSlope (%)

