


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: N/A	Main Street: WISDOM LN	Location: N/A
ADA ID: B71F445CF822	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

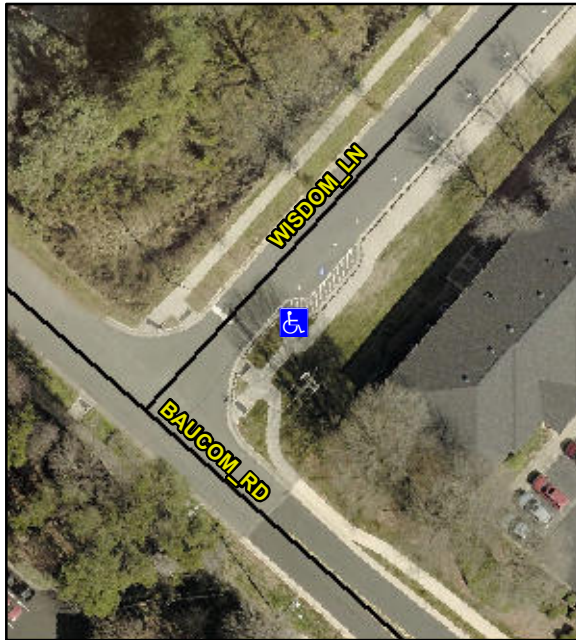

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

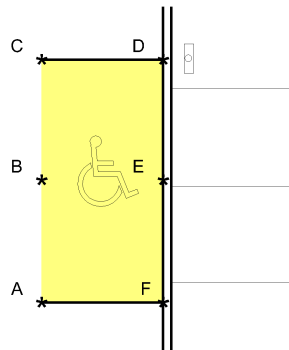

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	60.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	1.6	No	Access Aisle Width (in)	58.0
Yes	Adjacent Sidewalk XSlope (%)	1.4	No	Access Aisle Length (in)	276.0
No	Adjacent Sidewalk Clear of Obstr.	No	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		69.0	
	N/A	Parking Spot Length (in)		259.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)							
C Slope (%)	2.3	D Slope (%)	2.3	I Slope (%)	N/A	L Slope (%)	N/A	
B Slope (%)	1.4	E Slope (%)	2.0	H Slope (%)	N/A	K Slope (%)	N/A	
A Slope (%)	2.7	F Slope (%)	2.6	G Slope (%)	N/A	J Slope (%)	N/A	
N/A	Parking Space/Access Aisle XSlopes (%)							
C XSlope (%)	0.9	D XSlope (%)	1.0	I XSlope (%)	N/A	L XSlope (%)	N/A	
B XSlope (%)	0.2	E XSlope (%)	0.2	H XSlope (%)	N/A	K XSlope (%)	N/A	
A XSlope (%)	0.2	F XSlope (%)	0.6	G XSlope (%)	N/A	J XSlope (%)	N/A	

