


# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID: N/A	Main Street: W BLAND ST	Location: N/A
ADA ID: CAC300E0F80D	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

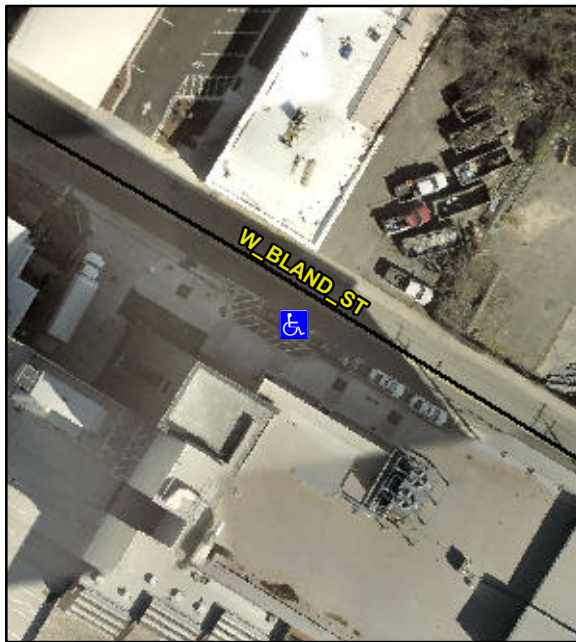

Possible Solutions:


**RestripeSpotAndAisle.**

Surveyor Notes:

**N/A**

PROW/ADA:

**TBD**

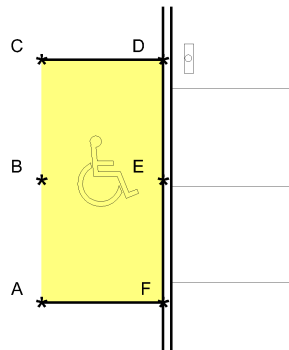

Total Cost: \$ \$0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	No	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	66.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	0.5	Yes	Access Aisle Width (in)	63.0
Yes	Adjacent Sidewalk XSlope (%)	0.5	No	Access Aisle Length (in)	325.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		80.0	
	N/A	Parking Spot Length (in)		259.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)					
C Slope (%)	0.9	D Slope (%)	0.6	I Slope (%)	N/A	L Slope (%)
B Slope (%)	0.6	E Slope (%)	0.6	H Slope (%)	N/A	K Slope (%)
A Slope (%)	0.9	F Slope (%)	1.3	G Slope (%)	N/A	J Slope (%)
N/A	Parking Space/Access Aisle XSlopes (%)					
C XSlope (%)	0.9	D XSlope (%)	0.2	I XSlope (%)	N/A	L XSlope (%)
B XSlope (%)	0.9	E XSlope (%)	0.5	H XSlope (%)	N/A	K XSlope (%)
A XSlope (%)	1.7	F XSlope (%)	1.0	G XSlope (%)	N/A	J XSlope (%)

