


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: N/A	Main Street: W TREMONT AV	Location: N/A
ADA ID: CC413339EECA	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

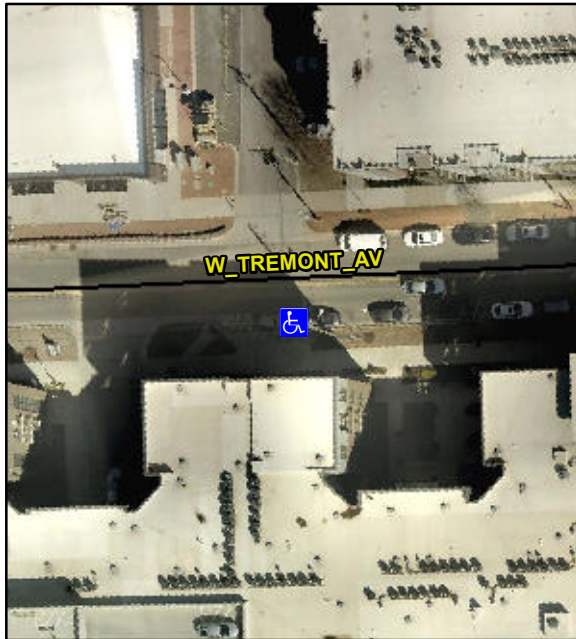

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

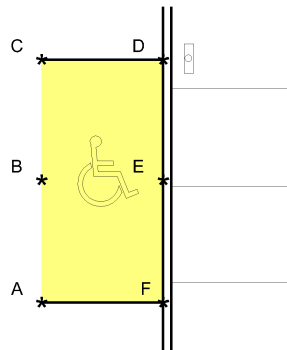

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	No	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	124.5	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	1.8	No	Access Aisle Width (in)	55.0
Yes	Adjacent Sidewalk XSlope (%)	0.2	Yes	Access Aisle Length (in)	262.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		80.0	
	N/A	Parking Spot Length (in)		262.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)						
	C Slope (%)	1.5	D Slope (%)	0.8	I Slope (%)	N/A	L Slope (%)
	B Slope (%)	1.8	E Slope (%)	1.2	H Slope (%)	N/A	K Slope (%)
	A Slope (%)	1.3	F Slope (%)	1.4	G Slope (%)	N/A	J Slope (%)
N/A	Parking Space/Access Aisle XSlopes (%)						
	C XSlope (%)	4.3	D XSlope (%)	0.4	I XSlope (%)	N/A	L XSlope (%)
	B XSlope (%)	3.8	E XSlope (%)	0.6	H XSlope (%)	N/A	K XSlope (%)
	A XSlope (%)	3.0	F XSlope (%)	0.4	G XSlope (%)	N/A	J XSlope (%)

