

# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID: N/A	Main Street: MILLENNIUM AV	Location: N/A
ADA ID: EB53D39DA549	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance



Possible Solutions:

**Advise relocating to an area with maximum 2% slopes**

Surveyor Notes:


**N/A**

PROW/ADA:

**TBD**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	N/A	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	72.0	No	Access Aisle Marking?	No
Yes	Adjacent Sidewalk Slope (%)	2.0	N/A	Access Aisle Width (in)	60.0
Yes	Adjacent Sidewalk XSlope (%)	0.2	N/A	Access Aisle Length (in)	236.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	N/A
	N/A	Parking Spot Width (in)	N/A		
	N/A	Parking Spot Length (in)	N/A		
	N/A	Van Accessible?	Yes		
	Yes	Curb Ramp?	Yes		
	N/A	Identification Sign?	No		
	N/A	Sign Height (in)	83.0		
	N/A	Vertical Clearance	N/A		
	N/A	Parking Meter?	No		
	N/A	Parking Meter Height (in)	N/A		
	N/A	Meter Operable Parts?	N/A		
	N/A	Meter Clear Space?	N/A		
	N/A	Meter Clear Space Slope (%)	N/A		
	N/A	Meter Clear Space XSlope (%)	N/A		
	N/A	Meter Forward Reach?	N/A		
	N/A	Meter Forward Reach (in)	N/A		
	N/A	Meter Parallel Reach?	N/A		
	N/A	Meter Parallel Reach (in)	N/A		

Total Cost: \$ \$0.00

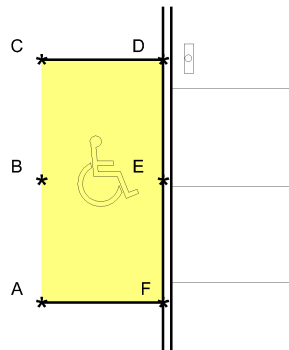

N/A	Parking Space/Access Aisle Slopes (%)							
	C Slope (%)	3.0	D Slope (%)	5.4	I Slope (%)	2.8	L Slope (%)	N/A
	B Slope (%)	2.8	E Slope (%)	3.5	H Slope (%)	2.1	K Slope (%)	N/A
	A Slope (%)	1.8	F Slope (%)	1.9	G Slope (%)	2.7	J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)							
	C XSlope (%)	3.0	D XSlope (%)	3.7	I XSlope (%)	1.6	L XSlope (%)	N/A
	B XSlope (%)	2.0	E XSlope (%)	0.4	H XSlope (%)	1.8	K XSlope (%)	N/A
	A XSlope (%)	1.4	F XSlope (%)	2.7	G XSlope (%)	2.6	J XSlope (%)	N/A

