


# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID: N/A	Main Street: SAM'S DR	Location: N/A
ADA ID: EF96E129297C	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

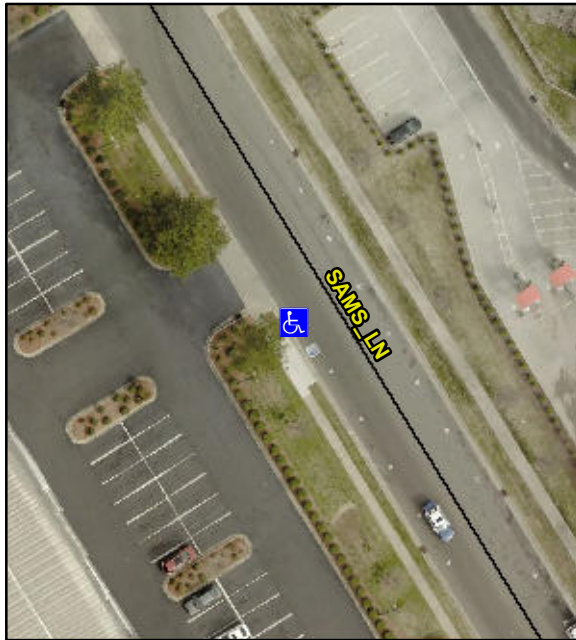

Possible Solutions:


**Advise relocating to an area with maximum 2% slopes**

Surveyor Notes:

**N/A**

PROW/ADA:

**TBD**

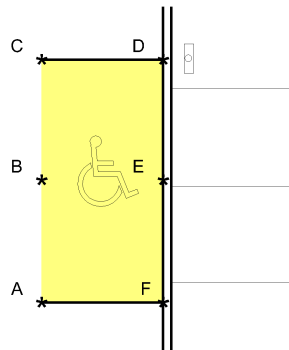

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	No	Accessible Route?	No
Yes	Adjacent Sidewalk Width (in)	98.0	No	Access Aisle Marking?	No
Yes	Adjacent Sidewalk Slope (%)	3.4	N/A	Access Aisle Width (in)	N/A
Yes	Adjacent Sidewalk XSlope (%)	1.5	N/A	Access Aisle Length (in)	N/A
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	N/A
	N/A	Parking Spot Width (in)		71.0	
	N/A	Parking Spot Length (in)		260.0	
	N/A	Van Accessible?		N/A	
	No	Curb Ramp?		No	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)					
	C Slope (%)	4.0	D Slope (%)	4.2	I Slope (%)	N/A
	B Slope (%)	3.9	E Slope (%)	4.6	H Slope (%)	N/A
	A Slope (%)	3.5	F Slope (%)	4.0	G Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)					
	C XSlope (%)	4.2	D XSlope (%)	5.9	I XSlope (%)	N/A
	B XSlope (%)	4.7	E XSlope (%)	6.7	H XSlope (%)	N/A
	A XSlope (%)	4.9	F XSlope (%)	5.2	G XSlope (%)	N/A
					L Slope (%)	N/A
					K Slope (%)	N/A
					J Slope (%)	N/A
					L XSlope (%)	N/A
					K XSlope (%)	N/A
					J XSlope (%)	N/A

