


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: N/A	Main Street: POTOMAC RIVER PY	Location: N/A
ADA ID: F04DDFABD8E1	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

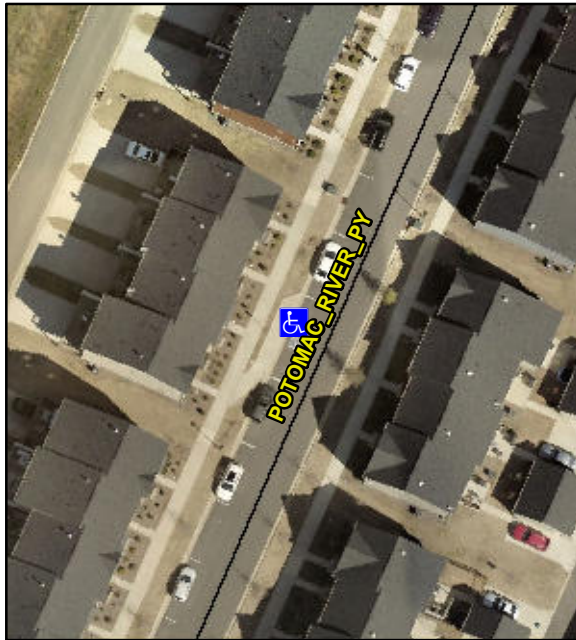

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

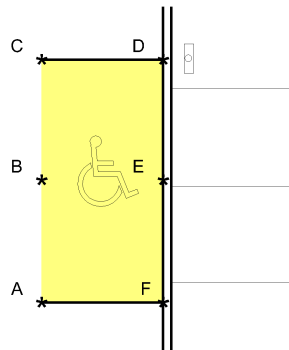

Total Cost: \$ \$0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	N/A	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	72.0	No	Access Aisle Marking?	No
No	Adjacent Sidewalk Slope (%)	2.9	N/A	Access Aisle Width (in)	56.5
Yes	Adjacent Sidewalk XSlope (%)	1.3	N/A	Access Aisle Length (in)	301.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	N/A
	N/A	Parking Spot Width (in)	N/A		
	N/A	Parking Spot Length (in)	N/A		
	N/A	Van Accessible?	Yes		
	Yes	Curb Ramp?	Yes		
	N/A	Identification Sign?	Yes		
	N/A	Sign Height (in)	85.0		
	N/A	Vertical Clearance	N/A		
	N/A	Parking Meter?	No		
	N/A	Parking Meter Height (in)	N/A		
	N/A	Meter Operable Parts?	N/A		
	N/A	Meter Clear Space?	N/A		
	N/A	Meter Clear Space Slope (%)	N/A		
	N/A	Meter Clear Space XSlope (%)	N/A		
	N/A	Meter Forward Reach?	N/A		
	N/A	Meter Forward Reach (in)	N/A		
	N/A	Meter Parallel Reach?	N/A		
	N/A	Meter Parallel Reach (in)	N/A		

N/A	Parking Space/Access Aisle Slopes (%)							
	C Slope (%)	2.7	D Slope (%)	2.8	I Slope (%)	1.4	L Slope (%)	N/A
	B Slope (%)	2.8	E Slope (%)	2.7	H Slope (%)	3.1	K Slope (%)	N/A
	A Slope (%)	3.0	F Slope (%)	3.0	G Slope (%)	1.9	J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)							
	C XSlope (%)	1.9	D XSlope (%)	2.3	I XSlope (%)	2.8	L XSlope (%)	N/A
	B XSlope (%)	1.8	E XSlope (%)	2.6	H XSlope (%)	3.4	K XSlope (%)	N/A
	A XSlope (%)	1.9	F XSlope (%)	2.8	G XSlope (%)	1.2	J XSlope (%)	N/A

