


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

| | | |
|---|-----------------------|---|
| Intersection ID: N/A | Main Street: E 8TH ST | Location: N/A |
| ADA ID: F9954F4D7000 | ParkingType: ParaPark | Overall Compliance: No |
| | | Severity Score: 0.0 |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance |

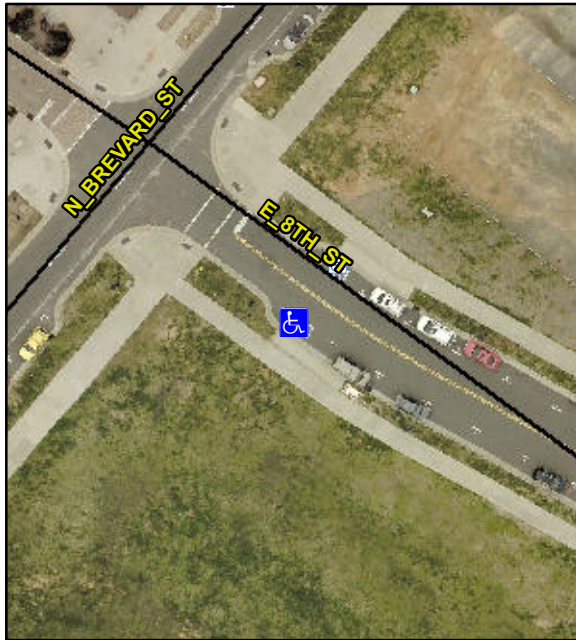

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

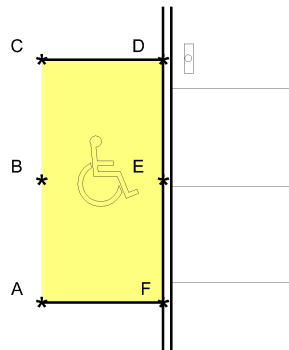

Total Cost: \$ **\$0.00**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------------------|------------------------------|------------|--------------------------|-------|
| N/A | Parking Spot At End of Block? | Yes | Yes | Accessible Route? | Yes |
| Yes | Adjacent Sidewalk Width (in) | 95.0 | No | Access Aisle Marking? | No |
| No | Adjacent Sidewalk Slope (%) | 4.5 | N/A | Access Aisle Width (in) | 66.0 |
| No | Adjacent Sidewalk XSlope (%) | 3.4 | N/A | Access Aisle Length (in) | 267.0 |
| Yes | Adjacent Sidewalk Clear of Obstr. | Yes | N/A | Access Aisle Location | Side |
| | N/A | Parking Spot Width (in) | | 92.0 | |
| | N/A | Parking Spot Length (in) | | 283.0 | |
| | N/A | Van Accessible? | | N/A | |
| | Yes | Curb Ramp? | | Yes | |
| | N/A | Identification Sign? | | N/A | |
| | N/A | Sign Height (in) | | N/A | |
| | N/A | Vertical Clearance | | N/A | |
| | N/A | Parking Meter? | | N/A | |
| | N/A | Parking Meter Height (in) | | N/A | |
| | N/A | Meter Operable Parts? | | N/A | |
| | N/A | Meter Clear Space? | | N/A | |
| | N/A | Meter Clear Space Slope (%) | | N/A | |
| | N/A | Meter Clear Space XSlope (%) | | N/A | |
| | N/A | Meter Forward Reach? | | N/A | |
| | N/A | Meter Forward Reach (in) | | N/A | |
| | N/A | Meter Parallel Reach? | | N/A | |
| | N/A | Meter Parallel Reach (in) | | N/A | |

| | | | | | | |
|-----|--|-----|--------------|-----|--------------|-----|
| N/A | Parking Space/Access Aisle Slopes (%) | | | | | |
| | C Slope (%) | 3.9 | D Slope (%) | 3.7 | I Slope (%) | N/A |
| | B Slope (%) | 4.4 | E Slope (%) | 3.1 | H Slope (%) | N/A |
| | A Slope (%) | 4.4 | F Slope (%) | 3.1 | G Slope (%) | N/A |
| N/A | Parking Space/Access Aisle XSlopes (%) | | | | | |
| | C XSlope (%) | 1.7 | D XSlope (%) | 1.6 | I XSlope (%) | N/A |
| | B XSlope (%) | 1.8 | E XSlope (%) | 1.8 | H XSlope (%) | N/A |
| | A XSlope (%) | 1.8 | F XSlope (%) | 3.7 | G XSlope (%) | N/A |
| | | | | | L Slope (%) | N/A |
| | | | | | K Slope (%) | N/A |
| | | | | | J Slope (%) | N/A |
| | | | | | L XSlope (%) | N/A |
| | | | | | K XSlope (%) | N/A |
| | | | | | J XSlope (%) | N/A |

