


# Access Compliance Report Public Rights-of-Way (RR Crossings)

Intersection ID: 12618	Main Street: E_5TH_ST	Location: N/A
ADA ID: CC3C8993546D	Overall Compliance: No	Severity Score: 0.0
<b>Codes/Mitigation Info/Possible Solution</b>	<b>Field Measurements/Component Compliance</b>	

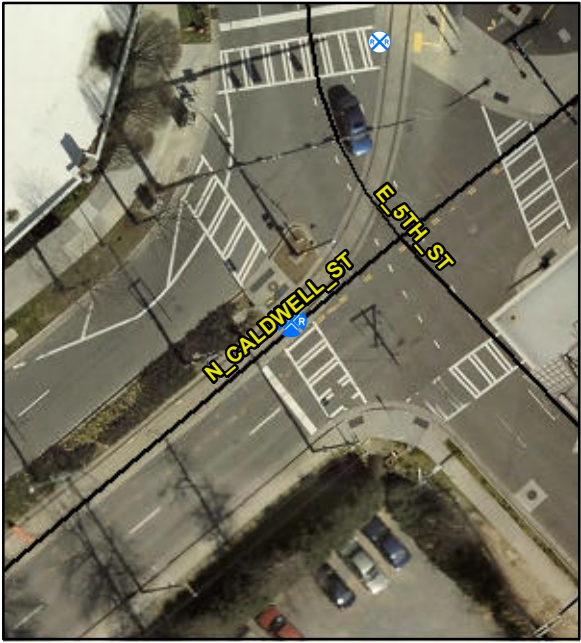

Possible Solutions:  
**Remove & Replace Detectable Warning System. Provide Pedestrian Gate.**

Surveyor Notes:  
**LIGHTRAIL IN STREET WITH MEDIAN REFUDGE ON ONE SIDE**

PROW/ADA:  
**R305.1.4, R305.2.5**

Compliance	Description	Data
Yes	DWS Provided?	Yes
Yes	DWS Contrast?	Yes
No	DWS Width (in)	No
Yes	DWS Length (in)	25.0
No	DWS Offset (in)	27.0
No	Pedestrian Gate?	No
N/A	DWS Outside Gate?	No
N/A	Rail Type?	LightRail
Yes	Flangeway Gap (in)	2.0
Yes	Sidewalk Width (in)	120.0

Total Cost: \$ 2800.00

